



September 24, 2024

IMPORTANT PRODUCT SERVICE BULLETIN

This Notice Applies to Ronin Power Ascenders with identification label located over the motor

Spartaco Tool Group recently documented instances where heat from the motor has caused the ID label to peel partially away from the unit and come in contact the motor cover vents.

This condition could create motor damage due to foreign object debris entering the vent area.

Affected units were all serial numbers:

1334 thru 1345, 1347, 1350, 1354 thru 1363, 1365, 1367, 1370, 1373 thru 1375, 1377, 1378, 1381, 1386 thru 1397, 1414, 1415, 1418 thru 1447, 1450 thru 1456, 1458 and 460.

If you have a unit included in the affected list, first check the vent area of the motor to determine if a label is present.

Label Check Procedure

Step 1: Remove the rubber motor cover from the back side of the unit by pulling/sliding off.



Step 2 Inspect the motor through the vent holes to identify if the label is on the motor. If label is observed move to the Label Removal Procedure, if there is no label install rubber motor cover back on unit and no additional service is required.





Label Removal Procedure

Step 1: Using 8mm Open End Box Wrench, remove three M5 Kep nuts from the motor cover.



Step 2: Slide one half of the motor cover off from the unit, rotate the motor until the ID label is in front, peel the label off.



Step 3: Install the motor cover back onto the unit, align the tab with the slot in the motor cover halves and secure using the three M5 Kep Nuts that were removed in Step 1.

