Shallow Canopy POWER CORD


Parts Overview

For illustration purpose only. Consult control manufacturer's spec. sheets for specigic wiring requirements and fixture capacity.





- A JUNCTION BOX (×1) (PROVIDED BY OTHERS)
- B CANOPY (×1)
- DRESS PLATE (×1)
- STRAIN RELIEF (×1)
- POWER CORD (x1)

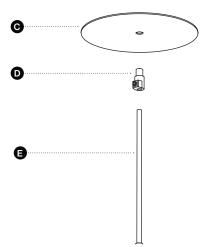

NOTICE

- Wire according to appropriate manufacturers wiring
- Warning: risk of shock from energized equipment.
- Always turn power off and lock out during fixture installation.
- This product must be installed in accordance with the applicable Installation code by a person familiar with the construction and operation of the product and the hazards involved.
- Suitable for damp locations.

WARNING

For illustration purposes only. Consult control manufacturer's spec. sheets for specific wiring requirements and fixture capacity.


- (1) Once the canopy is installed to junction box, loosen and remove the strain relief, and remove dress plate.
- ${f 2}$ Loosen the strain relief set screw. Feed the power cord into the strain relief and through the dress plate. Adjust to desired length.
- (3) Once the final hanging length is certain, trim cord so that about 2-3 inches extend into canopy. Strip back the outer jacker insulation about two inches on the cord to expose the internal conductors.
- (4) Connect GREEN (GROUND) wire in canopy to the GROUND wire of the supply circuit. Connect the WHITE (Input ACN) power supply wire to the WHITE (ACN) wire of the supply circuit. Connect the BLACK (Input ACL) power supply wire to the BLACK (ACL) wire of the supply circuit.
- Push the supply connections and all excess wires into the junction box.





Shallow Canopy POWER CORD

Step-by-step


- Install junction box. Refer to project-specific shop drawings provided by LightArt for exact locations. After installation locate the mounting holes for the canopy.
- Locate the mounting slots to install the canopy to the junction box.
- Secure canopy to junction box using fasterners

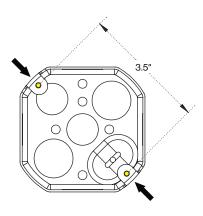

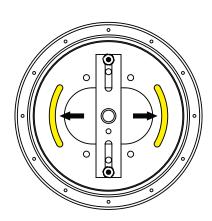

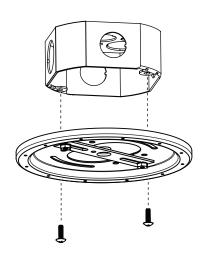

- Wiring: Refer to page 1 for wiring details.
- Lift the dress plate upward and hold it in place.

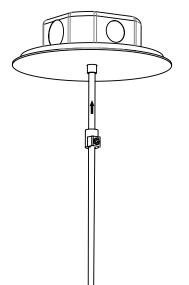

Lift the strain relief upward and screw it into the canopy. Tighten strain relief set screw once strain relief is in place.

