




Pacific Accessory Corporation

Radio Replacement Interface for Select Mazda Vehicles with Bose Sound Systems

Tech Brief

Description

There may be an occasion where a wire is missing in the harness. This wire being missing will cause the amplifier in the vehicle to not turn on. This can be easily fixed, in field, by the installer. The first picture below is of an affected harness. There should be a blue/white wire connecting pin 1 of the top connector to the red wire on the second connector.

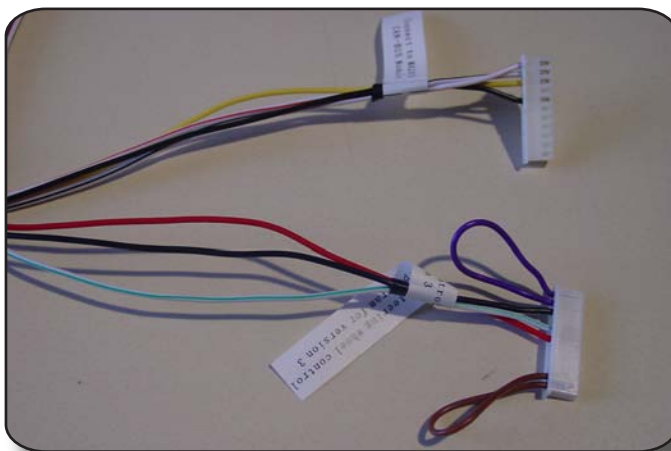

The Fix

Remove the brown loop from the connector B. This can be done using a pick tool and depressing the locking tab on the exposed pin in the connector. Once the brown loop has been removed from connector B, one side of the brown wire will need to be inserted into the #1 pin position on connector A (see pic below). The other side of the brown wire will need to be connected to the red wire on connector B.

