Starrett®

Electronic Height Gage
HG Series



USER MANUAL

HG Series Electronic Height Gage

READ THIS MANUAL BEFORE USING THE INSTRUMENT

For further information, please contact:

The L.S. Starrett Company
121 Crescent Street
Athol, MA 01331-1915 USA
Phone: (978) 249-3551
E-mail: sales@starrett.com
Fax: (978) 249-8495
Contact us

All specifications in this document are correct at time of production and are subject to change.

Dear customer,

Thank you for choosing a product by Starrett. We kindly request that you follow the instructions below to ensure the long-term precision of your instrument.

We operate a policy of continuous improvement and are constantly developing our products. Therefore, it is possible that there may be slight differences between the text and illustrations in this document and the instrument in your possession, especially with regard to type designations. We reserve the right to make changes to the design and scope of supply, the right to undertake further technical developments, and all rights relating to translation of this documentation.

© by The L.S. Starrett Company

The following symbols are used in this quick guide:



General information.



Important information. Failure to follow instructions marked with this symbol may cause inaccurate results and damage equipment.



Warning. Risk of injury or death. Must be observed!

Permitted uses

The HG Series height gage may only be used to measure lengths, distances, and diameters.

The HG Series height gage can be used both close to production and in measuring rooms.

Do not modify the instrument. This may create additional hazards against which the safety mechanisms cannot offer adequate protection.



Any use not in accordance with the “Permitted Uses” or any other use will be considered inappropriate and will result in a voided warranty and the manufacturer’s exclusion from liability.

Reasonably foreseeable misuse



Any incidental maintenance work may only be carried out by skilled, trained staff as directed by the operating company.



Work on any parts carrying live voltage must only be carried out once the power supply to the device has been disconnected and any potential residual voltage has been safely discharged.




Safety mechanisms on the device must not be disassembled or bypassed.



Only original probe systems, probe arm units and other accessories produced by the manufacturer may be used.

Disposal

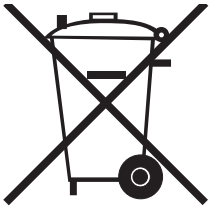

Old electronic equipment which was purchased from Starrett after March 23, 2006 can be returned to us.
We will dispose of this equipment in an environmentally-friendly way. The valid EU directives (WEEE, ElektroG) apply.

EU/UK Declaration of Conformity

This height gage complies with the applicable EU/UK directives.

A copy of the current Declaration of Conformity can be downloaded from www.starrett.com/products by selecting the relevant product or can be requested from the following address:
The L.S. Starrett Company, 121 Crescent Street, Athol, MA 01331-1915 USA

We reserve the right to make changes to our products, especially due to technical improvements and further developments.
All illustrations, numerical values, etc. are therefore subject to change.

Traceability

We declare, with sole responsibility, that this product conforms with standards and technical data as specified in our sales documents (operating instructions, leaflet, catalog).

We certify that the testing equipment used to check this product, and guaranteed by our Quality Assurance, is traceable to national standards.

Thank you for placing your trust in us by purchasing this product.

Update

The latest version of the software, firmware, and user manual is available to download on our website (https://www.starrett.com/UM-HG). Please note the relevant notes about the version when updating software and firmware. Applicable catalog numbers listed below.

Catalog Number	EDP
HG350	62473
HG600	62474
HG1000	62475

Scan here to access latest version of the software, firmware and user manual.



Safety instructions

This height gage complies with the relevant safety regulations. It was dispatched from our production facility in a perfect condition. However, failure to follow the instructions given below can cause personal injury or death:

1. Before you connect up and use the height gage for the first time, please read the accompanying documentation.

2. Only use the instrument in accordance with this quick guide.

   Keep the documentation close to the place of use ready for quick reference.

3. This instrument is not designed for operation in explosive environments. An electrical spark could trigger an explosion.

4. Follow safety precautions, accident prevention regulations, and internal company guidelines. You should request further information from your company safety officer.

5. Only the AC adapter provided with the device should be used for charging the internal rechargeable battery or supplying power to the device when used in stationary applications.

6. Before you connect up the equipment, check that the power supply voltage marked on the type plate of the AC adapter matches that of the local mains power supply system. Do not under any circumstances connect the AC adapter if the voltage is not the same!

7. Only use the AC adapter in enclosed areas.

8. The instrument may only be connected to a properly grounded protective contact socket.

9. Only Starrett-trained service personnel are permitted to carry out work on this instrument. Protective covers must only be removed by trained technicians and only when servicing is required. Any procedures carried out on this instrument that go beyond those tasks described in the quick guide will void the equipment warranty. Starrett declines all liability for damage caused by unauthorized procedures.

10. Do not use cleaning agents that contain harmful substances. Do not use solvents. Do not allow any fluids to penetrate the instrument.

11. Inspect the connecting cables for damage. Change damaged cables immediately (Starrett service personnel).

12. Never move the height gage instrument forcefully at the edge of the measuring surface. The air cushion at the edge does not dissipate quickly enough to slow down the movement of the height gage. It could fall off the plate and injure the user.

13. The height gage must only be transported in its original packaging. Otherwise the warranty will be void.

Table of Contents

Permitted uses **1**
Reasonably foreseeable misuse **1**
Safety instructions **3**
1 General information **7**
1.1 Scope of delivery 7
1.2 Assembly and setup 8
2 Elements of the height gage **11**
2.1 On/off switch 11
2.2 Control panel 11
2.3 Measuring slide 12
2.4 Carrier for measuring probes 12
2.5 Quick measurement function keys 12
2.6 Thumbwheel 13
2.7 Button for air bearing 13
2.8 Ports 14
3 User interface of the HG Series software **15**
3.1 Status bar 15
3.2 Menu bar 15
3.3 Information area 16
3.4 Function key bar 16
4 Setup **20**
4.1 Initial setup 20
4.1.1 Switching ON 20
4.1.2 Basic settings 20
4.2 Reference point run 21
4.3 Calibrate the probe 21
4.4 Zero point on the measuring plate 22
4.5 Workpiece zero point 22
4.6 Zero point offset 22
4.7 Measuring methods 23
4.7.1 Basic measuring functions 23
4.7.2 2D mode 23
4.7.3 Quick mode 24
4.7.4 Measuring program mode 25
4.7.5 Measuring results 25
5 Annex **26**
5.1 Maintenance and care 26
5.2 Cleaning the instrument 26
5.3 Charging the battery 26
5.4 Technical data 27
5.5 Device information 28
5.6 Accessories 29
6 Alphabetical index **30**

1 General information

HG Series is an electronic height gage used for measuring and evaluating lengths, distances, and diameters.

It allows you to safely perform measurements and calculation functions, as well as create measuring programs to automate recurring measuring steps.

The height gage is operated via a swivel and tilting control panel with touchscreen. The HG Series features fast measurement function keys as well as a thumbwheel, which allows convenient positioning of the measuring slide.


The user interface of the height gage offers clearly structured menus and large buttons with self-explanatory icons to ensure quick and fluid processes.

The handles on each side and the integrated air bearing ensure that the instrument can be moved precisely and effortlessly on the measuring plate.

The HG is available in three sizes HG350, HG600 and HG1000.

The height gage enables one-dimensional measurements in a vertical direction and two-dimensional measurements if the workpiece can be tilted 90°.


1.1 Scope of delivery

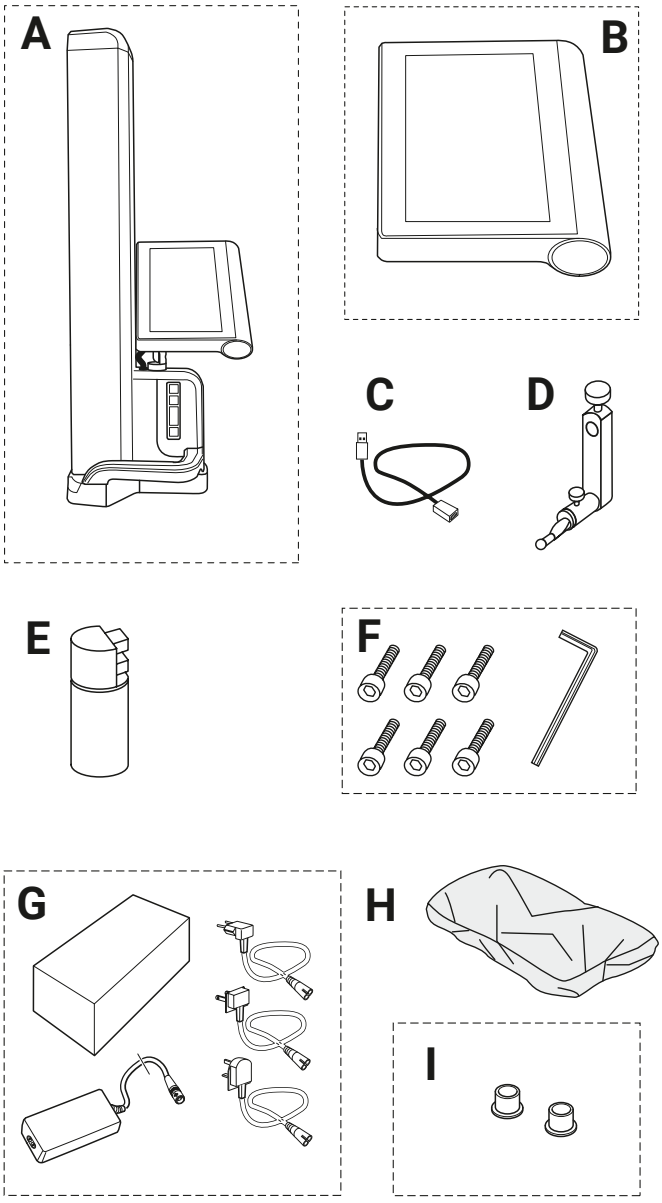


A Height gage
B Control panel with touch screen
C Connecting cable for control panel
D Carrier for measuring probes
E Setting normal
F Cylinder head screws and Allen key
G AC adapter with plug adapter
H Protective cover
I Blind caps

1.2 Assembly and setup

Unpack the control panel

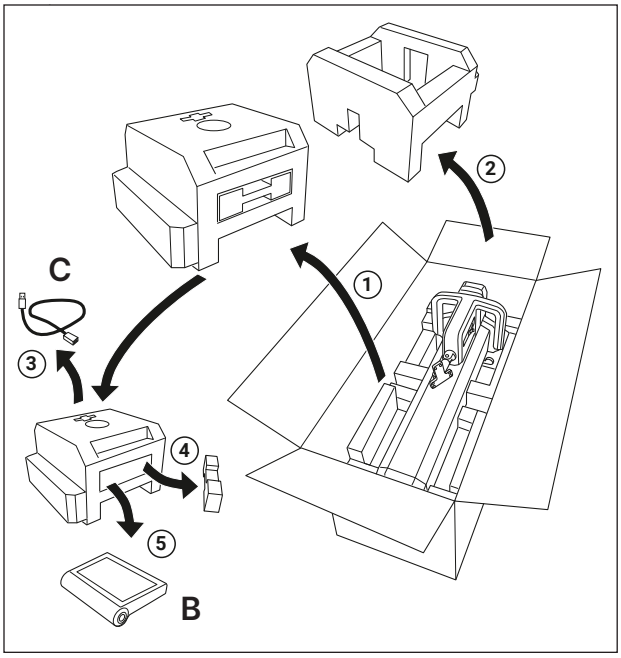


Align the carriers for measuring probes and undo the measuring slide fixture

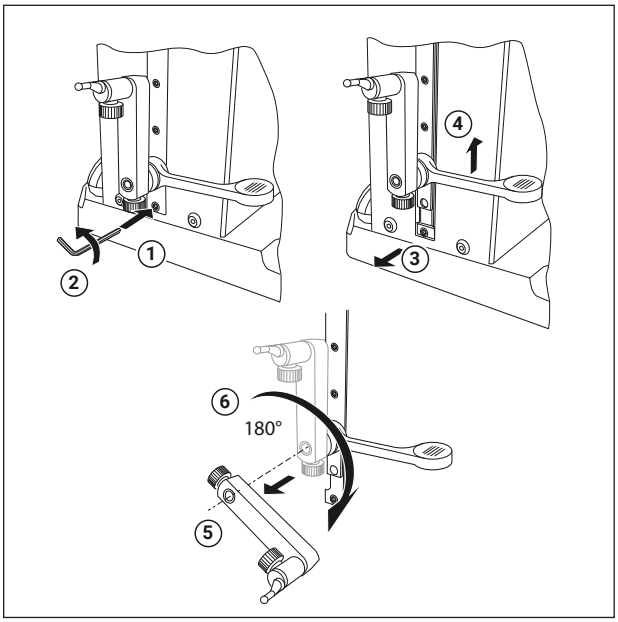


Unpack the columns of the height gage:


13.8 in 55.1 lb
23.6 in 66.1 lb
(39.4 in 77.2 lb)

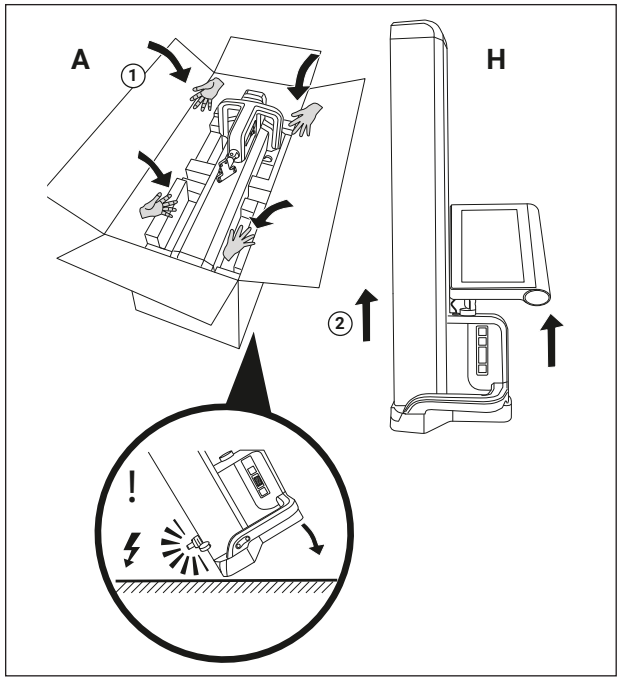


Remove the guard bracket

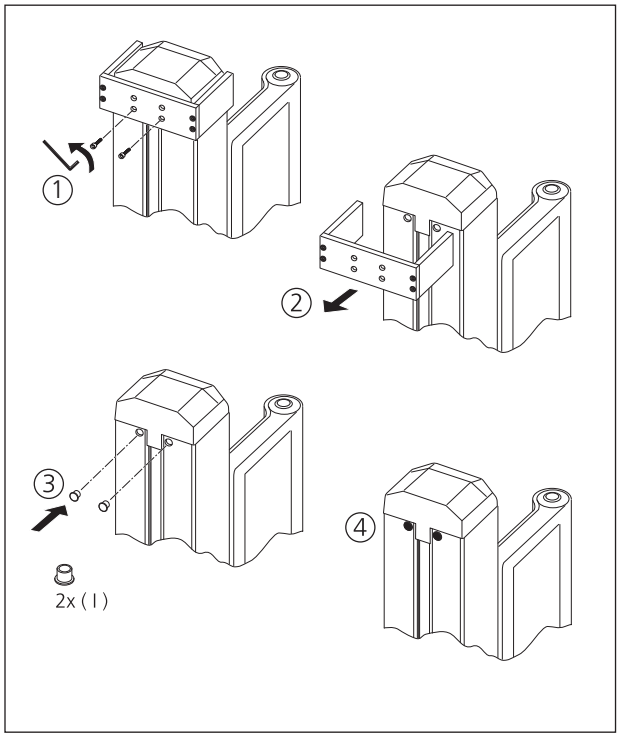


Unpack the AC adapter

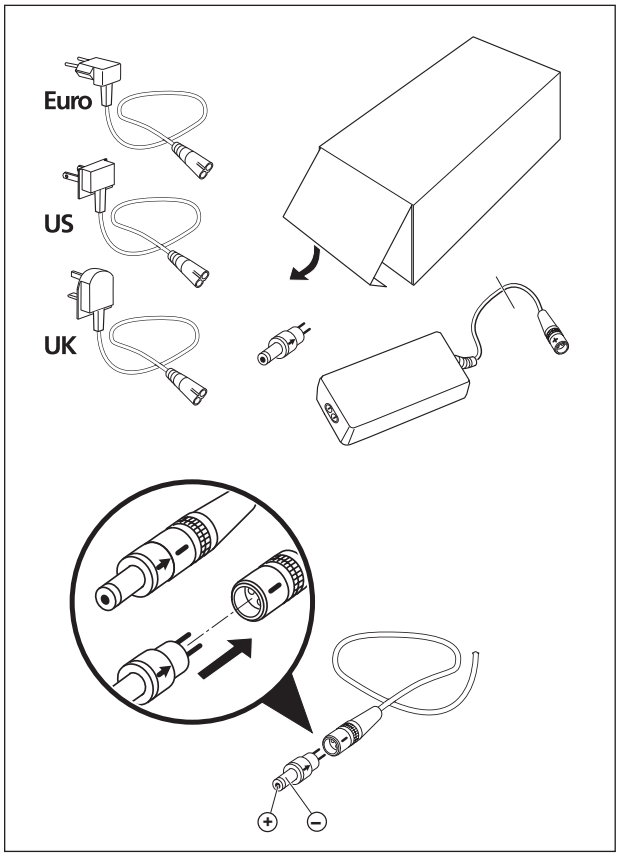


Insert the battery

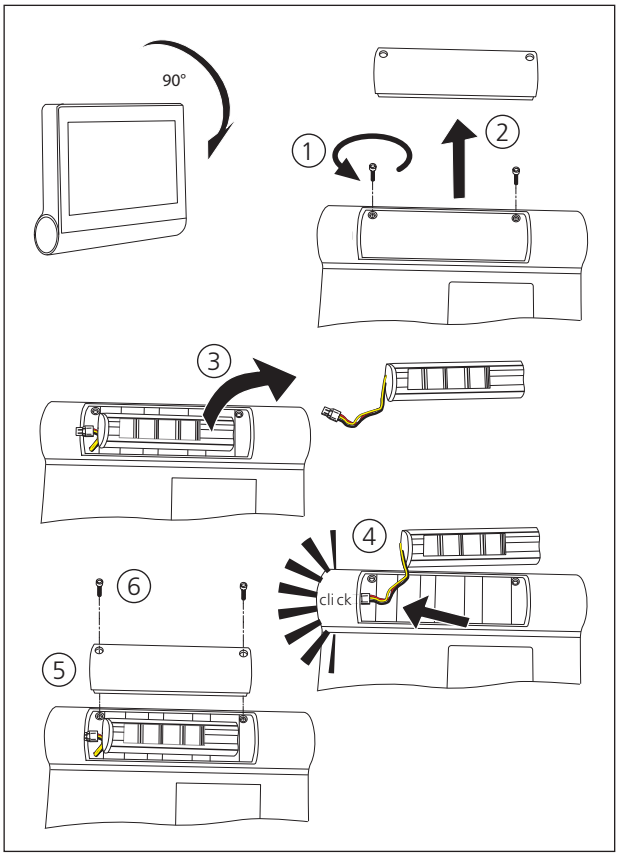

Secure and connect the control panel

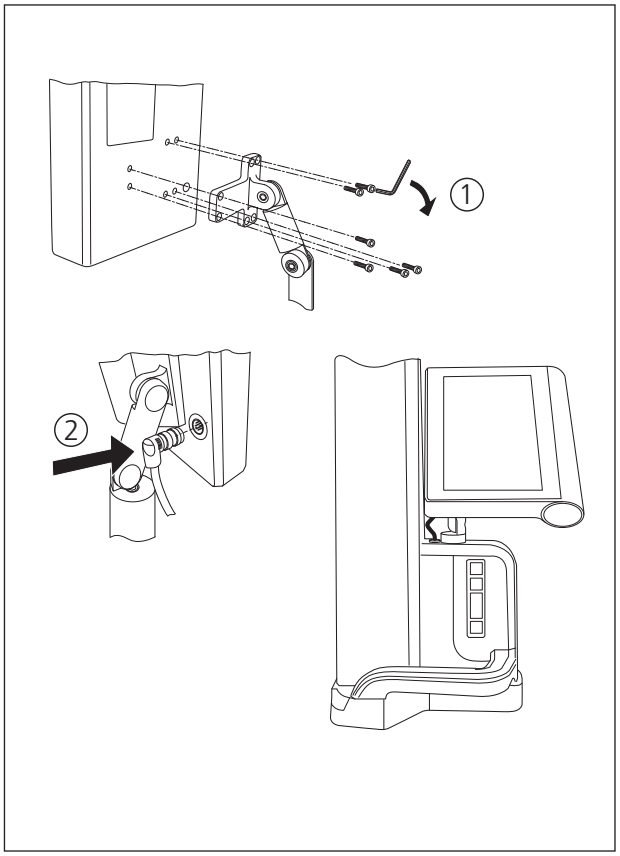

Connect the AC adapter

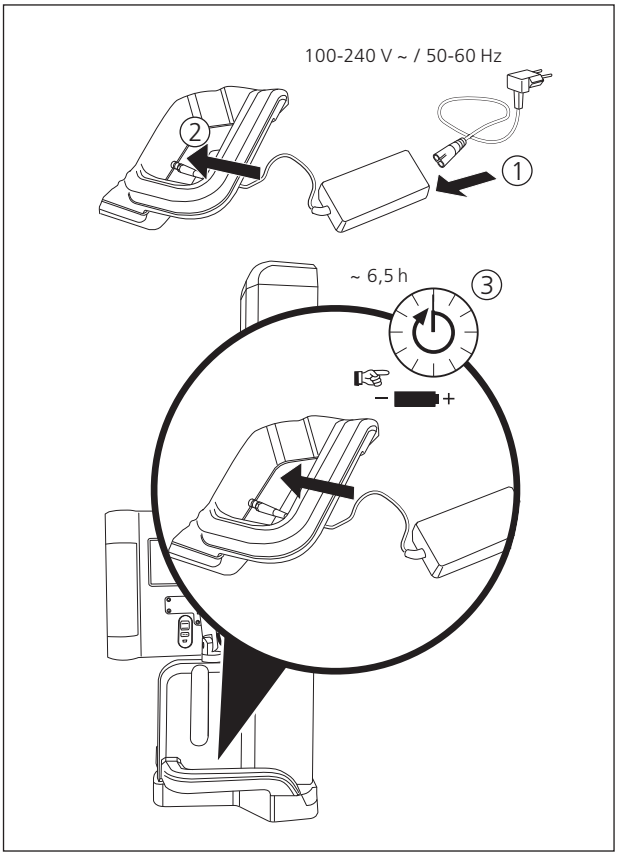

2 Elements of the height gage

The height gage HG350, HG600 and HG1000 comprises the following elements:



Fig. 1
Elements of the height gage

1. *Carrier for measuring probes*
2. *Column of the height gage with measuring slide*
3. *Control panel with on/off switch*
4. *Quick measurement function keys and thumbwheel*
5. *Ports (back of instrument)*
6. *Handles on both sides (with button for air bearing)*

2.1 On/off switch

There is an on/off switch for the height measuring instrument above the control panel.



Fig. 2
On/off switch

2.2 Control panel

The control panel features a swivel and tilt joint on the HG Series

The user interface of the HG software is displayed on the touchscreen of the control panel.

2.3 Measuring slide

The measuring slide is in the column of the height gage and holds the carriers for the measuring probes.

The measuring slide features a positioning handle, which can be used to manually move the measuring slide in a vertical direction.

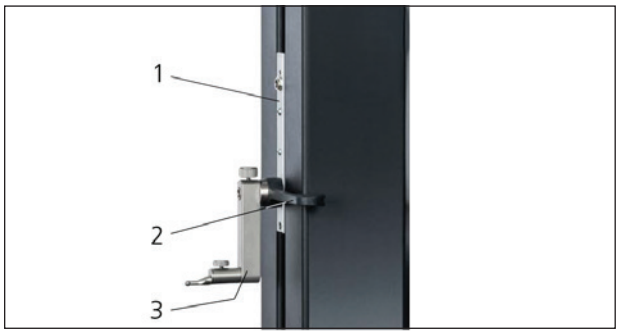


Fig. 3
Measuring slide

1. *Measuring slide*
2. *Positioning handle*
3. *Standard holder with measuring probe*

The overall height of the column depends on the size of the chosen height gage:

- **HG350:** Height 27.09 in/688 mm (measuring range 14"/350 mm)
- **HG600:** Height 36.93 in/938mm (measuring range 24"/600mm)
- **HG1000:** Height 52.68 in/1338mm (measuring range 40"/1000mm)

2.4 Carrier for measuring probes

The carrier for the measuring probes can be used to hold different probes. The instrument comes with standard holder and measuring probe (PTHGSPR).

Other carriers and measuring probes are available.

2.5 Quick measurement function keys

Only available on the HG Series.

Using the quick measurement function keys on the HG Series, a measurement can be started quickly without having to select it in the user interface of the Starrett software.

The quick measurement keys include a toggle key, which can be used to toggle between “plane” and “bore” measurements.

The quick measurement function keys are located on the base of the height gage.

Starts a measurement in the positive direction by moving the probe up to contact the workpiece from below.

Starts a measurement in the negative direction by moving the probe down to contact the workpiece from above.

Toggles the measurement type:

“Plane” for a single point measurement

“Bore” measurement for a double point measurement

The status bar of the user interface displays the icon of the active measurement.

2.6 Thumbwheel

The thumbwheel is used to quickly move and position the probe in a positive and negative direction.



Fig. 4
Thumbwheel

The travel speed corresponds to how far away the thumbwheel is from its central position, i.e. the further up the thumbwheel is moved, the faster the probe moves in a positive direction.

2.7 Button for air bearing

An air bearing can help you position the height gage precisely by ensuring that it moves accurately and effortlessly on the measuring plate.

There is a button fitted on the handle of the height gage to activate the air bearing.

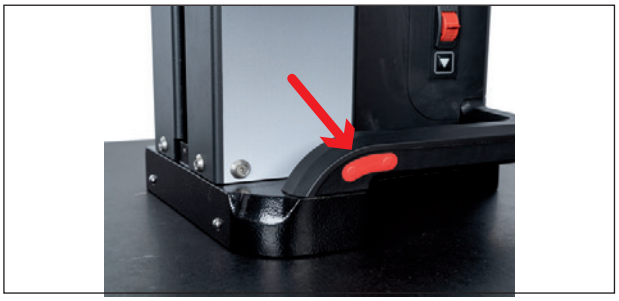


Fig. 5
Button for activating the air bearing

The button and the handles help to move the height gage properly.



Fig. 6
Handles for moving the height gage



Fig. 7
Moving the height gage using the activated air bearing



Fig. 9
USB sockets
1. *Mini USB*
2. *1 x USB 3.1 (black)*
3. *2 x USB 3.1 (white)*
4. *8-pin round plug for powering the control panel*

2.8 Ports

The height gage offers the following connection options:

- USB 3.1 sockets (type B) For connecting:
  - USB memory stick with firmware and software updates, measuring programs, customer logos as well as PDF/Text files

3 User interface of the HG software

The user interface consists of

- Status bar
- Menu bar
- Information area
- Function key bar

The elements of the user interface are explained in detail in the online help of the HG software.

3.1 Status bar

The status bar is on the top edge of the user interface and contains the following elements (from left to right):

- Current date and current time
- Unit of the measuring system
- Activation status of numerical corrections
- Measurement type (plane or bore)
- Current battery status




Fig. 10
Status bar of the user interface
Basic measuring functions

3.2 Menu bar

The menu bar is on the right-hand edge of the user interface and contains the following buttons and display elements:

Opens the “Settings” menu for defining the software settings.

Switches the context-sensitive online help on or off.

Allows you to set zero points.

Allows you to calibrate the probe.

Switches quick mode on or off.

Indicates that data transfer to a USB memory stick is enabled.

Indicates that data transfer via i-stick using “MarCom Professional” software is enabled.

Indicates that data transfer via mini USB cable using “MarCom Professional” software is enabled.

Indicates that data transfer to a wireless printer is enabled.

Aborts the current action or deletes the highlighted entries from the measuring value list in the information area.

Confirms the current action.

Toggles to other measuring functions to be selected in the function key bar

Toggles to any measuring functions to be selected beforehand in the function key bar.

3.3 Information area

The top part of the information area displays the current measuring value / the current measuring result calculations. The middle section of the information area displays the measuring value list with the results of the measuring functions performed.

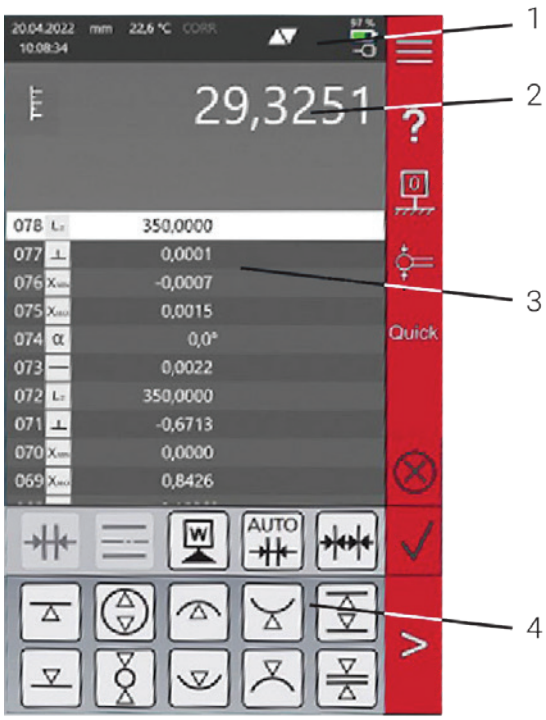


Fig. 11
User interface of the HG software

1. *Menu bar*
2. *Current measuring value*
3. *Measuring value list*
4. *Function key bar*

When measuring program mode is activated, elements for managing measuring programs and results files are displayed in the information area.

3.4 Function key bar

The function key bar is located below the information area. It contains the buttons for selecting a function. The following buttons are available depending on the mode selected:

Calibrate the probe

- Calibrate with groove
- Calibrate with ledge
- Calibrate double probe
- Calibrate cone probe

Set zero points

- Base zero point measuring plate
- Zero point 01 workpiece
- Zero point 02 workpiece
- Zero point 03 workpiece
- Preset entry

Basic measuring functions

 Contacting from below

 Contacting from above

 Bore

 Shaft

 Bore top

 Bore bottom

 Shaft bottom

 Shaft top

 Groove

 Ledge

 Bore center

 Min-Max

 Cone measurement

 Perpendicularity measurement



Enable 2D mode



Enable measuring program mode



Output measuring results as measuring record file in PDF format



Output measuring results as Text file

Calculation functions

 Distance calculation

 Symmetry calculation

 Set zero point workpiece



Automatic distance calculation

 Automatic chain measurement

Other buttons for functions

If other information is possible for any of the functions, the following buttons are displayed in the function key bar depending on the function:

 Move measuring probe upwards and contact

 Move measuring probe downwards and contact

 Stop measurement and calculation of measuring results

 Pause measurement

 Set measuring plate as reference for the measuring results



Calculate the relative result values for “Min-Max function”



Calculate absolute result values for “Min-Max function”



Set X-value and Z-value to zero, e.g. in “perpendicularity measurement”

Measuring functions in 2D mode


Enter tilting angle manually


Calculate tilting angle with dial comparator or dial indicator


Tilt workpiece to the right


Tilt workpiece to the left


Bore


Shaft


Bore center


Show graph


Alternative zero point


Alternative reference axis


Index circle


Regression line


Angle between two straight lines


Intersection point


Distance



Output measuring results as measuring record file in PDF format



Output measuring results as Text file

Manage measuring program


Allows you to run the measuring program currently highlighted in the file list


Allows you to create a new measuring program


Allows you to edit the measuring program currently highlighted in the file list


Deletes the measuring program(s) currently highlighted in the file list from an internal memory in the height gage


Copies all of the measuring programs to the connected USB memory stick


Copies all of the measuring programs from the connected USB memory stick to the internal memory of the height gage

Manage results files


Deletes the results file(s) currently highlighted in the file list from the internal memory of the height gage


Displays the contents of the results file currently highlighted in the file list


Copies all results files to the connected USB memory stick

Edit measuring programs

The buttons below add the relevant function as a measuring step:


“Contacting from below” measuring function


“Contacting from above” measuring function


“Bore” measuring function


“Shaft” measuring function


“Bore top” measuring function


“Bore bottom” measuring function


“Shaft bottom” measuring function


“Shaft top” measuring function


“Groove” measuring function


“Ledge” measuring function


“Bore center” measuring function


Function
“Base zero point measuring plate”


“Distance calculation” calculation function


“Symmetry calculation” calculation function


“Delay” function


“Set zero point workpiece” calculation function

Running measuring programs


Starts running the measuring program


Performs the next measuring step in the measuring program


Stops the measuring program


Pauses the measuring program


Skips to the previous measuring step


All of the functions are explained in detail in the online help of the HG software.

4 Setup

4.1 Initial Setup

The height gage is recommended for use with Grade AA and Grade A surface plates. Acceptable for use on Grade B surface plates. The measuring plate must stand on vibration-free ground (vibrations from stamping die or the like must not be transmitted).

The height gage must be correctly assembled and connected before initial setup.

The AC adapter must be connected to the charging socket. After approx. 5 minutes the battery is charged enough for the height gage to be switched on.

4.1.1 Switching ON

- To switch on the height gage, press the on/off switch above the control panel.
- As soon as the operating system of the height gage starts up, the user interface of the HG software will appear on the control panel.

4.1.2 Basic settings

When starting up for the first time, some parameters such as language and unit of measurement need to be set. To do so:

- Press the button in the menu bar of the user interface.
- In the “Settings” menu that now appears, press the button for the “Instrument settings” in the menu.
- The “Instrument settings” screen is displayed in the user interface.
- In this screen, set the current date, the time and the language for the HG software.
- If applicable, specify a time interval for the height gage to automatically switch off.
- If applicable, specify a time interval for the display backlight to automatically switch off.
- If applicable, set the brightness for the backlight of the display.
- Activate password protection if necessary.
- Once all of the settings have been defined, repeatedly press the button in the menu bar of the user interface to apply the entries and close the “Settings” menu.

The settings options are explained in detail in the online help of the HG software.

4.2 Reference point run

A reference point run is performed automatically as soon as the height gage is switched on, whereby the probe is moved in the positive and then in the negative direction. The zero point of the Z-axis is set on the measuring plate during this process.

The zero point can be set anywhere, e.g. on a workpiece surface using the “zero point 01 workpiece” function.

If you want to extend the working area of the height gage, a surface can be contacted at a certain height and this height can be set as the zero point offset using the “Preset entry” function.

4.3 Calibrate the probe

- Insert the desired measuring probe in the carrier on the measuring slide and place the setting gage on the measuring plate.
- Press the button in the menu bar of the user interface.
- Press the button for the desired calibration process in the function key bar.

Calibrate with groove

Calibrate with ledge

Calibrate double probe

Calibrate cone probe

- Manually position the measuring probe to the relevant height for the calibration process, e.g. to the height of the groove center of the setting gage when the “Calibrate with groove” function is selected.
- Move the setting gage so that the measuring probe is in the groove.



Fig. 12
Positioning the setting gage when calibrating with groove

- The calibration process is performed automatically. An animation of the calibration process is shown in the user interface for the purpose of visual control.
- The calculated probe constant is displayed in the top section of the information area.
- The individual calibration processes are explained in detail in the online help of the HG software.

4.4 Zero point on the measuring plate

- Press the button in the menu bar of the user interface.
- If other workpiece zero points have already been set, the button of the current zero point will appear in the menu bar. In this case, press this button.
- Press the button in the function key bar of the user interface.
- The probe automatically moves onto the measuring plate and assumes the contacted position as the zero point.
- Any zero points previously set (01, 02 and 03 as well as Preset) are automatically deleted during this process.

4.5 Workpiece zero point

- Contact the surface whose position is to be used as the zero point.
- Press the button in the menu bar of the user interface.
- If other workpiece zero points have already been set, the button of the current zero point will appear in the menu bar. In this case, press this button.
- Press the button for the zero point to be set in the function key bar:

Zero point 01 workpiece

Zero point 02 workpiece

Zero point 03 workpiece

- Press the button in the menu bar to set the workpiece zero point.

4.6 Zero point offset

The measuring range of the height gage can be extended with a zero point offset. For example, the height 5.91 in can be assigned to a position of 1.97 in with a zero-point offset of 3.94 in, meaning the measuring range shifts by 3.94 in.

- Press the button in the menu bar of the user interface.
- If other workpiece zero points have already been set, the button of the current zero point will appear in the menu bar. In this case, press this button.
- Press the button in the function key bar of the user interface.
- The “PR” input box and a dialog box with numerical keypad are displayed in the information area of the user interface.
- Enter the value of the zero point offset using the numerical keypad and press the button in the menu bar to accept the entered value.
- The measuring range is extended by the entered value.

4.7 Measuring methods

4.7.1 Basic measuring functions

The basic measuring functions can be started quickly and easily at the push of a button.

The procedure here is always the same:

- Position the measuring probe above/below the point to be measured.
- Press the button of the desired measuring function in the function key bar of the user interface.
- The measuring probe automatically approaches the surface to be measured and accepts the measuring value.

For dynamic measurements where a maximum or minimum (bores or shafts) is to be measured, you need to move either the workpiece or the height gage in such a way that the height gage can calculate an extreme value. In measurements with two consecutive contacting processes (e.g. bore, groove, or shaft), the first contacting process is always performed upwards.

The individual measuring functions are explained in detail in the online help of the HG software.

4.7.2 2D mode

Common 2D measuring tasks can be completed with the measuring functions in 2D mode, including calculations of index circles (hole circle) or angles and distances between bores. To this end, the measurements of the Z and X axes are each measured and saved separately.

The sequence of measuring functions in 2D mode is always as follows:

- Activate 2D mode by pressing the 2D button.
- Measure the features in the Z-axis.
- Tilt/rotate the workpiece (usually 90°) by pressing the or button.
- Measure the features again in the same order in the X-axis.
- If other features are to be measured in the Z-axis, the workpiece must be tilted back again by pressing the / button.
- Perform the calculations, e.g. “index circle”.

When 2D mode is activated, the function key bar of the user interface displays the relevant buttons for the possible measuring functions.

The results of the measurements performed can be displayed as a measuring value list or graph in the information area of the user interface.

The graph can be switched on or off by pressing the button.

The individual measuring functions in 2D mode are explained in detail in the online help of the HG software.

4.7.3 Quick mode

In quick mode, the system automatically identifies the desired measuring function based on the measuring slide movement and starts it automatically.

Quick mode can be used, for example, to conduct chain measurements or several bores (e.g. in hole circle calculations) quickly and efficiently.

To activate quick mode:

- Press the Quick button in the menu bar of the user interface.
- When quick mode is activated, the lettering on the button is green.
- Press the toggle key for the type of measurement on the base of the height gage.
- The status bar displays the icon of the active measurement

▲▼ "Plane" measurement for single point measurement.

▲ ▼ "Bore" measurement for double point measurement.

- Move the measuring probe to a position at the point to be measured, e.g. above the surface to be contacted.
- Gently move the slide towards the surface to be contacted, e.g. downwards, using the positioning handle

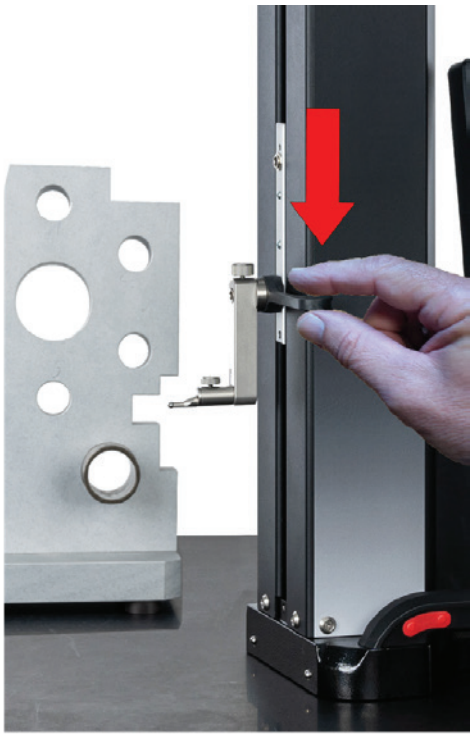


Fig. 13
Move the slide down using the positioning handle

- The instrument recognizes that the surface is to be contacted and starts the measuring function automatically.
- After contacting, the measured value is accepted and displayed in the top section of the information area.

A measurement in quick mode can be aborted at any time by pressing the ⊗ button in the menu bar of the user interface.

4.7.4 Measuring program mode

Measuring program mode allows you to automate recurring measuring steps by creating, saving (as a file), and then running a measuring program.

The results of a measuring program can be saved and displayed as a results file in PDF and/or Text format.

To activate measuring program mode:

- Press the ☰ button in the menu bar of the user interface, and select “Programs” from the “Settings” menu that now appears.
- Or press the PROG button in the function key bar of the user interface.
- Measuring program mode is enabled and the “Programs” screen appears.

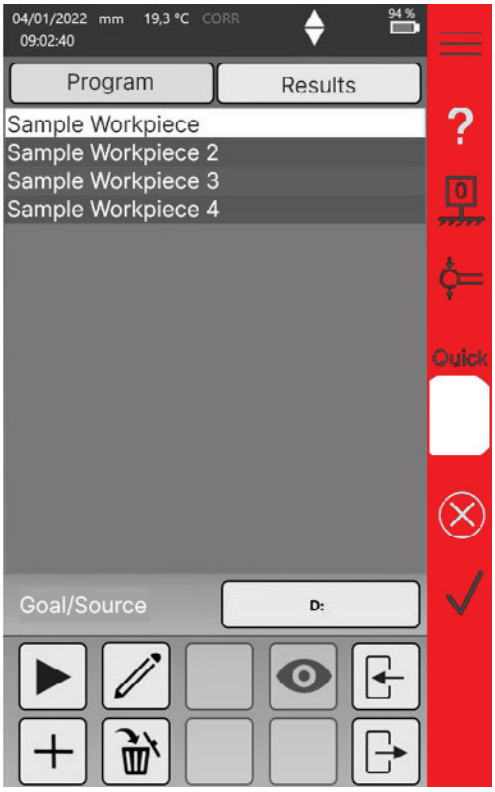


Fig. 14
“Programs” screen

- In the “Programs” screen, you can select and manage measuring programs as well as the results files of measuring programs that have run.

When measuring program mode is activated, the function key bar of the user interface displays the relevant buttons for managing measuring program and results files and for editing measuring programs.

The online help of the HG software explains in detail how to create, edit, and run a measuring program.

4.7.5 Measuring results

Measuring results can be saved in PDF and/ or Text files.

The online help of the HG software explains in detail how to create and output PDF and Text files.

5 Annex

5.1 Maintenance and care

Make sure that the measuring plate is always kept clean. Dust, oil and coolant emissions must be removed from the measuring plate every day.

Dirt on the air bearings has a detrimental effect on measuring behavior and accuracy.

The battery can be changed without the data stored in the instrument being lost.

5.2 Cleaning the instrument

The instrument can be cleaned using a damp cloth. When cleaning, do not allow any liquids to penetrate the instrument!

Do not use solvents or detergents that are corrosive or harmful to plastics for cleaning.

The air bearings can be cleaned with methylated spirits (alcohol).

5.3 Charging the battery

To charge the battery, the AC adapter must be connected to the charging socket. The charge status of the battery is displayed in the status bar of the user interface (

).

The AC adapter can also be permanently connected, as an overload fuse monitors the charging process. The battery continues to charge when the height gage is switched off ().

A disconnected battery will also be displayed in the status bar ().

Batteries discharge over time even when they are not in use. Discharged batteries can lose their capacity or become completely unusable. The battery should therefore be charged every 6 months.

Never short-circuit the battery.
There is a risk of fire and explosion!

The height gage should always be operated with the battery inserted.

5.4 Technical data

		HG350	HG600	HG1000
Measuring range	Inches	0-14"	0-24"	0-40"
	Millimeters	0 - 350 mm	0 - 600 mm	0 - 1000 mm
Resolution	Inches	0.0005 / 0.0002 / 0.00005 / 0.00002 / 0.000005 in		
	Millimeters	0.01 / 0.005 / 0.001 / 0.0005 / 0.0001 mm		
Error limit	Inches	(0.000071 + L/23.622 × 0.0003937) in		
	Microns	(1.8 + L/600) L in mm		
Repeatability	Inches	0.0000197 in		
	Microns	0.5 µm		
Repeatability: bore	Inches	0.0000394 in		
	Microns	1 µm		
Perpendicularity deviation	Inches	0.000197 in	0.000236 in	0.000394 in
	Microns	5 µm	6 µm	10 µm
Measuring force	Lbf	0.225 ± 0.067 lbf		
	N	1.0 +/- 0.3 N		
Measuring speeds	in/s	0.20 / 0.31 / 0.43 / 0.59 / 0.79 in/s		
	mm/s	5 / 8 / 11 / 15 / 20 mm/s		
Maximum positioning speed				
- manual	in/s	39.37 in/s		
	mm/s	1000 mm/s		
- motorized thumbwheel	in/s	3.15 in/s		
	mm/s	80 mm/s		
Drive		motorized		
Compressed air supply		built-in compressor		
Vertical measuring system of the column		incremental measuring system		
Resolution of vertical measuring system	Inches	0.00000394 in		
	Microns	0.1 µm		
Working temperature	°F	68 °F		
	°C	20°C		
Operating temperature	°F	50 to 104 °F		
	°C	10 °C to 40°C		
Storage temperature	°F	14 to 140 °F		
	°C	-10 °C to 60°C		
Permitted relative humidity		max. 65% (non-condensing)		
Temperature sensor error limit	°F	±0.45 °F		
	°C	±0.25°C		

	HG350	HG600	HG1000
Power supply	12 VDC / 3.8 A		
Supply voltage / mains frequency	100 - 240 V AC / 50 - 60 Hz		
Operating time, maximum	14 h		
Battery voltage	7.2 V		
Battery capacity	11500 mAh		
Rechargeable battery type	Lithium-ion battery		
Protection rating	IP40		

5.5 Device information

		HG350	HG600	HG1000
Weight	lb	48.94 lb	56.44 lb	63.05 lb
	kg	22.2 kg	25.6 kg	28.6 kg
Dimensions	Inches	10.04 × 10.94 × 27.09	10.04 × 10.94 × 36.93 in	10.04 × 10.94 × 52.68 in
	Millimeters	255 × 278 × 688 mm	255 × 278 × 938 mm	255 × 278 × 1338 mm

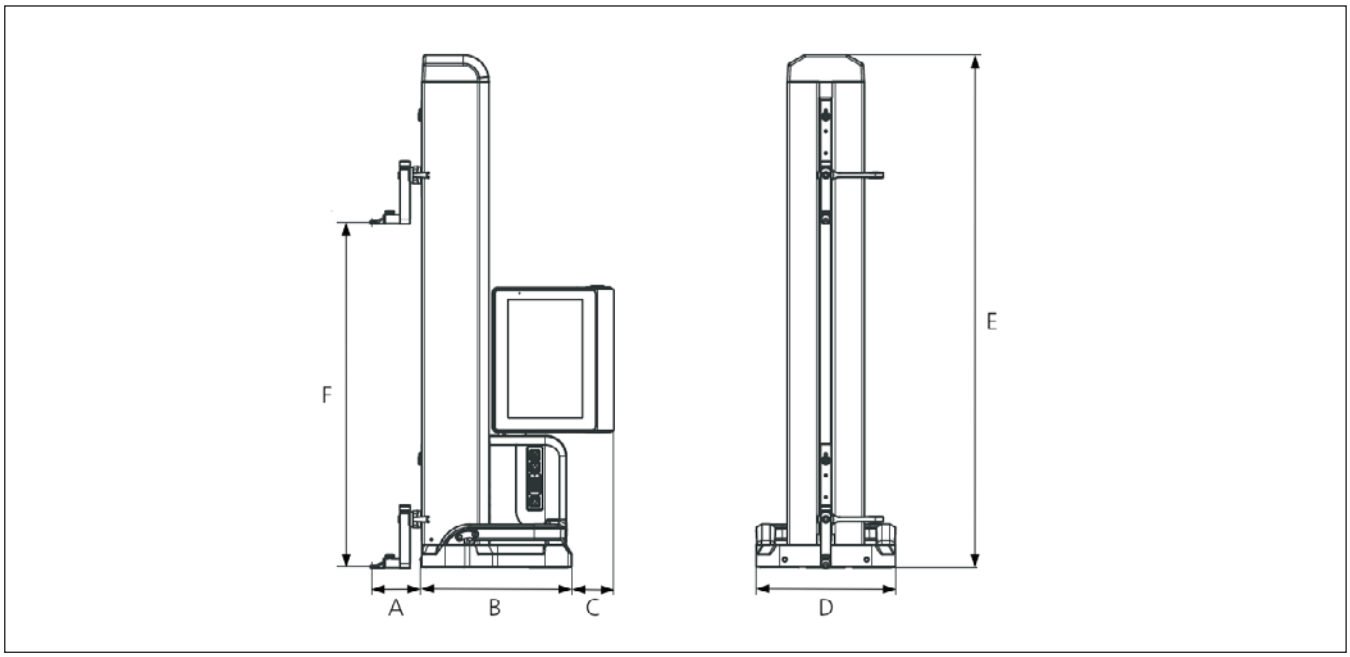


Fig. 15
Instrument dimensions
A 3.51 in (89.2 mm)
B 10.94 in (278.0 mm)
C 3.03 in (77.0 mm)
D 10.04 in (255.0 mm)
E 27.09 in (688 mm) / 36.93 in (938 mm) / 52.68 in (1338 mm)
F 0 - 14 in (0 - 350 mm) / 0 - 24 in (0 - 600 mm) / 0 - 40 in (0 - 1000 mm)

5.6 Accessories

HG Series Accessories		
Cat. No.	EDP	Description
PTHGSPR	62642	Replacement Probe for HG350, HG600, HG1000
PTHGSP	62643	Probe Set for HG350, HG600, HG1000
HGDB	62644	Height Gage Demo Part

Granite Surface Plates & Compatible Stands								
Cat. No.	EDP	Size LxWxT	Ledges	Grade (U.S.)	Stationary Stand Options		Rolling Stand Options	
					Cat. No.	EDP	Cat. No.	EDP
G-88655	88655	24×36×6 in (600×900×150 mm)	0	AA Laboratory	G-82228	82228	G-82229	82229
G-88658	88658	24×36×6 in (600×900×150 mm)	0	A Inspection				
G-88710	62644	36×48×8 in (900×1200×200 mm)	0	AA Laboratory	G-82234	82234	G-82235	82235
G-88713	88713	36×48×6 in (900×1200×150 mm)	0	A Inspection				

6 Alphabetical index

Symbols

2D mode 18, 23

A

Abort action 14
Accessories 29
Activate air bearing 13
Air bearing 13
Assembly and setup 8
Automatic switch off 20

B

Basic measuring functions 17, 23
Battery status 15

C

Calculation functions 17
Calibrate the probe 16, 21
Calibration process 21
Carrier for the measuring probes 12
Chain measurements 24
Charging the battery 26
Cleaning 26
Confirm action 15
Connection options 14
Context-sensitive online help 15
Control panel 11

D

Date 15, 20
Device information 28
Double point measurement 12
Dynamic measurements 23

E

Edit measuring programs 19
Elements of the height gage 11
Extended working area 21
Extend measuring range 22

F

Function key bar 16, 23

G

General information 7
Granite plate 20
Graph 23

I

Information area of the user interface .16, 23
Initial Setup 20
Insert the battery 9
Instrument settings 20
I-stick 14

L

Language 20

M

Measuring equipment 14
Maintenance and care 26
Manage results files 18
Managing measuring programs 18
Measuring functions in 2D mode 18, 23

Measuring program mode 25
Measuring result display 16
Measuring results 25
Measuring slide 12
Measuring value list 16
Menu bar 15
Millimess socket 14
Mini USB socket 14
Move probe down 12
Move probe up 12

O
Online help 15
On/off switch 11
Other functions 17

P
Password protection 20
Positioning handle 12, 24
Position probe quickly 13
Probe constant 21
“Programs” screen 25

Q
Quick measurement function keys 12
Quick mode 24

R
Reference point run 21
Running measuring programs 19

S
Safety instructions 3
Scope of delivery 7
Setup 20
Settings 20
Set zero points 16
Show data transfer 15
Single point measurement 12
Start measurement 12
Switching on 20
Swivel and tilt joint 11

T
Technical data 27, 28
Thumbwheel 13
Time 15, 20
Toggle key 12, 24

U
Unit of measurement 20
Unit of the measuring system 15
USB wireless stick 14
USB memory stick 14
USB sockets 14
User interface 15, 20

W
Workpiece zero point 22

Z
Zero point 21
Zero point offset 21, 22
Zero point on the measuring plate 22

North America
www.starrett.com
Athol, MA, USA, 01331-1915

Europe & Asia
www.starrett.co.uk
Jedburgh, Scotland, TD8 6LR

South & Central America
www.starrett.com.br
13306-900, ITU, SP, Brasil
CNPJ 56.994.700/0001-01

China
www.starrett.com.cn

user manuals available online
starrett.com