


1. Login Allxon Device Manager and find the OOB enabler you are going to update
2. Find the IP Address and copy the IP address and paste it into your browser's address bar. to enter

### Allxon WEB GUI

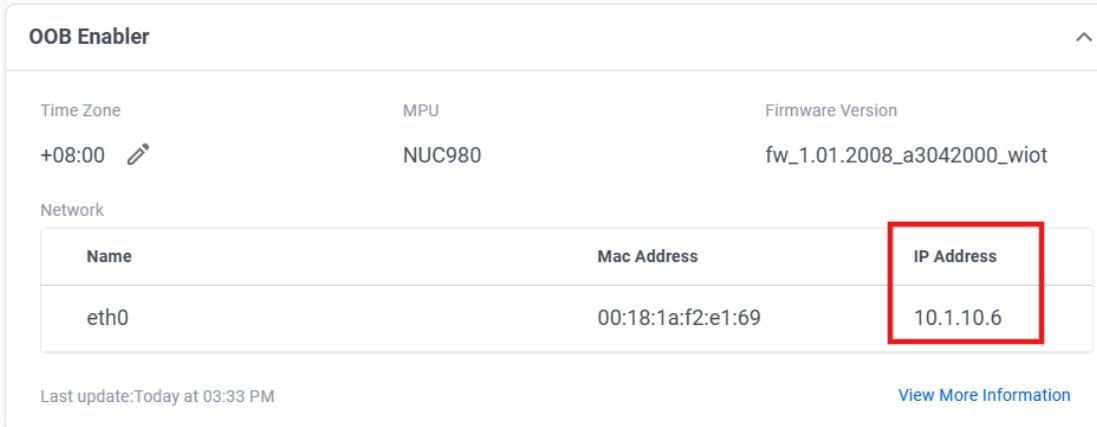


The screenshot shows the 'OOB Enabler' configuration page. It displays basic device information: Time Zone (+08:00), MPU (NUC980), and Firmware Version (fw\_1.01.2008\_a3042000\_wiot). Below this, a 'Network' table lists an interface: Name (eth0), Mac Address (00:18:1a:f2:e1:69), and IP Address (10.1.10.6, highlighted with a red box). At the bottom, it shows a 'Last update: Today at 03:33 PM' and a 'View More Information' link.


3. Enter Username and Password to login

**Username:** admin

**Password:** oobadmin

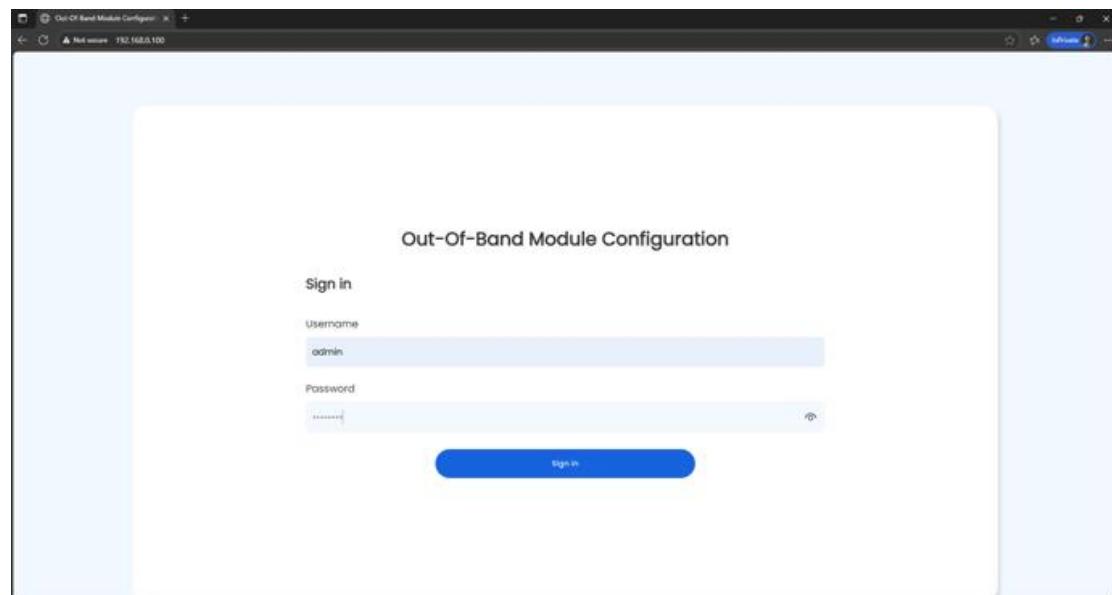

4. Find the Firmware Upgrade field and click on the Choose File button to upload the downloaded firmware patch for the update.

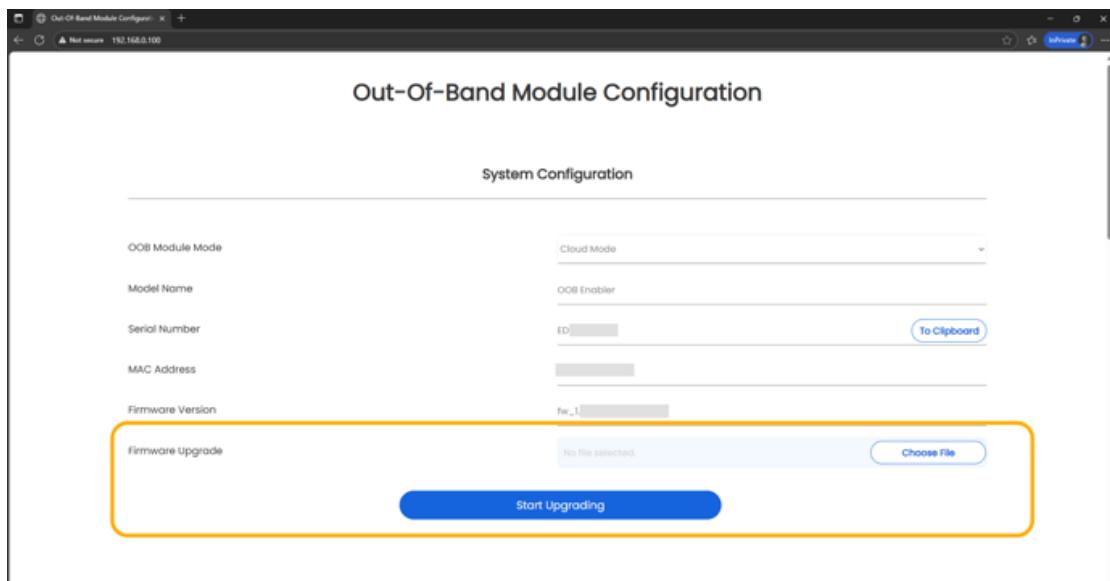

5. The system will reboot automatically after the update. Once the reboot is complete, check the firmware version on the Allxon Portal.

The screenshot shows the 'OOB Enabler' configuration page on the Allxon Portal. It includes a 'Time Zone' field set to +08:00, an 'MPU' field set to NUC980, and a 'Firmware Version' field set to fw\_1.01.2008\_a3042000\_wiot, which is highlighted with a red box. The 'Network' section shows an interface named 'eth0' with a Mac Address of 00:18:1a:f2:e1:69 and an IP Address of 10.1.10.6. A 'View More Information' link is located at the bottom right.