


For information about other American International automotive accessories visit our website at:

<http://www.americaninternational.net>



**American
International**
Car Stereo Installation Kits & Accessories

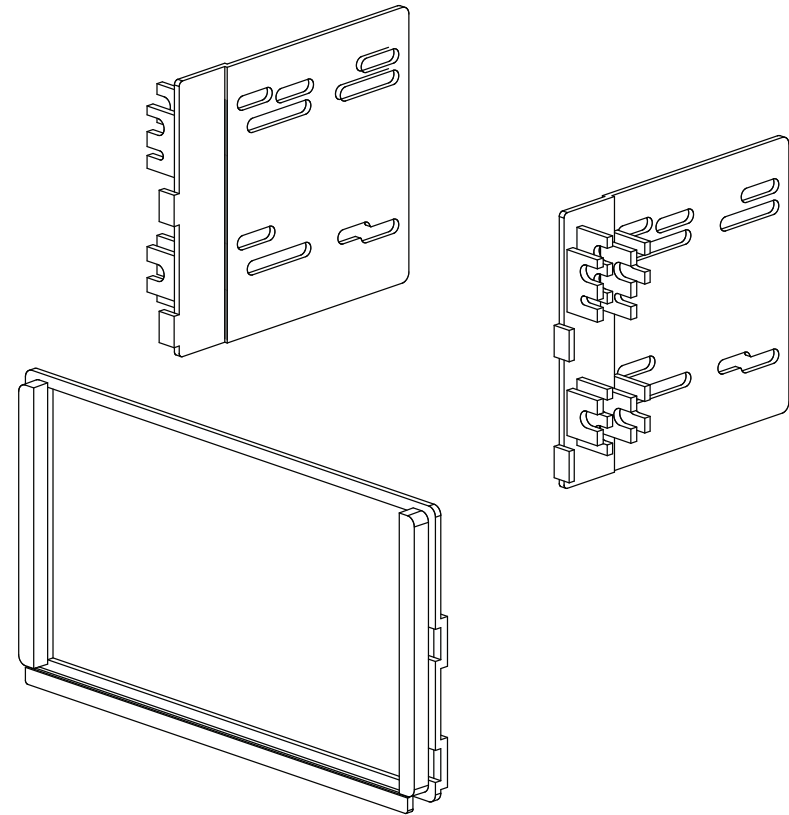

KIAK1242 Mounting Kit

VEHICLE APPLICATIONS

KIA

2001-05 OPTIMA
2001-05 RIO
2002-05 SEDONA
1999-02 SEPHIA
2003-06 SORENTO LX
2000-03 SPECTRA
1998-02 SPORTAGE

CUSTOMER HELP LINE
USA 800-323-4329 • Canada 800-245-8777

iKIA1242

DASH DISASSEMBLY

2001-05 Kia Rio

DASH DISASSEMBLY

1998-2000 Kia Sportage

DASH DISASSEMBLY

2001-02 Kia Sportage

DASH DISASSEMBLY

NOTES

NOTES

8. Remove the (3) Phillips screws from the bottom of the steering column cover, and remove the top and bottom covers.
9. Remove the (1) Phillips screw from under the upper edge of the dash in the center of the radio opening.
10. Remove the (2) Phillips screws securing the drink tray to the dash panel and remove the drink tray.
11. Carefully unsnap the dash trim and disconnect all harnesses and remove.
12. Remove the (4) Phillips screws securing the radio to the sub-dash.
13. Carefully pull the radio forward and disconnect the wire harness and antenna lead from the radio and remove radio.

2001-05 Kia Optima

DASH DISASSEMBLY

1. Open the ashtray.
2. Starting at the bottom, carefully unsnap the trim bezel around the radio.
3. Disconnect all harnesses from the climate controls, hazard button and clock and remove the trim bezel.
4. Remove the (4) Phillips screws securing the radio to the sub-dash.
5. Pull the radio forward, disconnect the wire harness and antenna lead and remove the radio.

2003-06 Kia Sorento LX

DASH DISASSEMBLY

- 1) CAUTION: You must start at the bottom of the side trims in (STEP 2) of this instruction and follow carefully, or damage to the trims will occur. These trims are very delicate.
- 2) Starting at the bottom and working your way to the top, Using a panel removal tool, carefully pry outward to unclip the left and right side (front portion only) narrow dash trim pieces that go from the sides of the ash tray to beside the radio. Pull upward to release the clips from the top portion of each trim, then pull towards you to release the trims and remove.
- 3) Remove the (6) Phillips screws that are securing the top section of the radio trim bezel.
- 4) Remove the (2) Phillips screws that are securing the lower section of the radio trim bezel.
- 5) Carefully pull the trim bezel forward, disconnect the harnesses from the rear of the bezel and remove bezel.
- 6) Remove the (4) Phillips screws securing the radio to the sub-dash, pull the radio forward, disconnect the wire.

2002-05 Kia Sedona

DASH DISASSEMBLY


1. Set the emergency brake.
2. Open the ashtray lid and remove the ash cup.
3. Remove the (1) Phillips screw from under the ash cup location.
4. Carefully unsnap the ashtray assembly / dash trim bezel, disconnect all harnesses from the ashtray / lighter assembly and remove the trim. ((Continued on page 4)

5. Remove the (4) Phillips screws securing the climate control panel to the sub-dash.
6. Turn the ignition key to the on position, depress the brake pedal and place the shift lever in the LOW position.
7. Carefully pull the Climate control panel / vent assembly forward, disconnect all harnesses connected to the control panel / vent assembly, and remove the panel.
8. Remove the (4) Phillips screws securing the factory radio to the steel sub-dash frame.
9. Gently pull the radio forward, disconnect the wire harness and antenna lead, and remove the radio.

ASSEMBLY INSTRUCTIONS


1. See Figure A.
2. Remove all mounting tabs from both sides of ISO mount brackets except those for your vehicle application (See Figure B).
3. Attach left and right ISO mounting brackets to main bracket.
4. Install radio into kit using screws supplied with radio (Do not tighten screws at this time).
5. Adjust radio forward or backward for best look.
6. Tighten screws after adjusting radio.

Fig. A

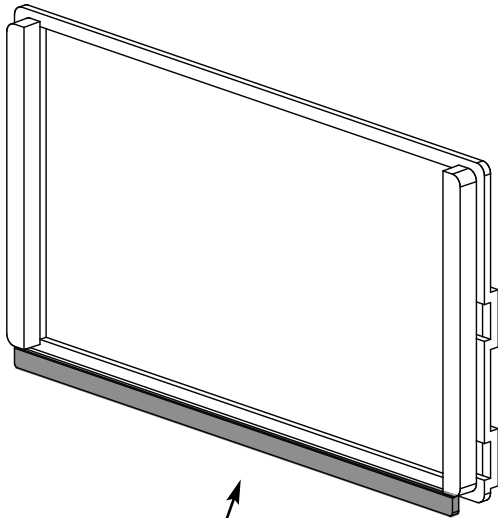

**2001-2005 Kia Optima DO NOT remove bottom trim.
For ALL other installations remove bottom trim.**

Fig. B

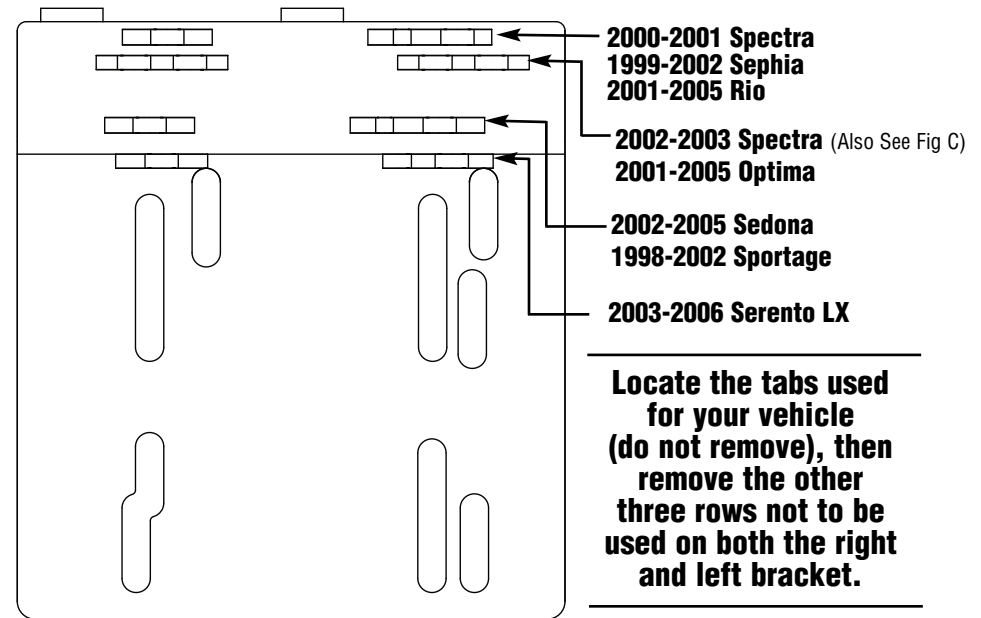

VIEW OF RIGHT SIDE BKT.

FOR 2002-2003 SPECTRA VEHICLES ONLY

Fig. C

LEFT BRACKET



CUT OR TRIM PLASTIC 5/16" INWARD FROM THE OUTER EDGE OF THE LOWER MOUNTING TABS AS ILLUSTRATED ON BOTH LEFT AND RIGHT MOUNTING BRACKETS SHOWN IN FIGURE B

RIGHT BRACKET

