





Q9 Hi-Temp Riser Kit For G2* Stainless Steel Meters

*New style G2 meters only (without bottom cover plate)

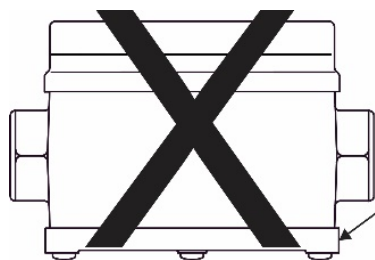

Old style G2 meter
Kit will not work with this style meter

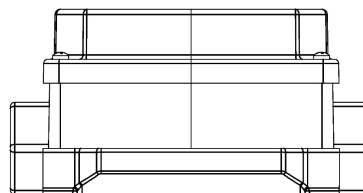


New style G2 meter
Kit is for this style meter

KIT INCLUDES:

- (1) Riser.
- (1) Seal.
- (4) Screws, 4-40 x 1.25

INSTALLATION INSTRUCTIONS:

1. Remove the display from your meter by removing the (4) corner screws that attaches it to the meter body. These screws will be replaced by the longer screws in the kit.
2. Carefully lift the display from the meter body; unplug the coil wire connector from the bottom of the display PC board; and lay the display aside. Ensure the seal remains seated in the display groove.
3. Place the seal provided with the kit into the seal groove of the riser, seating it carefully. Next, locate the riser onto the meter body. The internal protrusions and the raised boss on the side of the riser have no functionality in this application.
4. Retrieve the previously removed display, ensuring its seal is still seated; plug the coil wire connector back into the display PC board; and place the display on the riser.
5. Fasten the stacked components together with the (4) screws provided with the kit. Ensure both seals are properly seated before tightening the (4) screws.

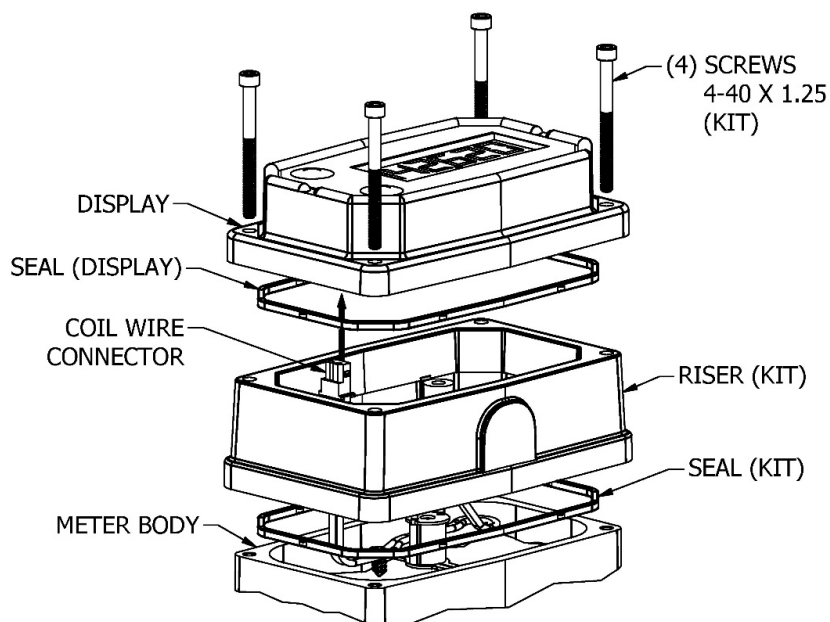

Wichita · Sydney

GREAT PLAINS INDUSTRIES



© 2021 Great Plains Industries, Inc., All Rights Reserved.
Great Plains Industries, Inc. / 888-996-3837 / flomecmeters.com